



NUMBER: 09-009-18

GROUP: 09 - Engine

DATE: September 14, 2018

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

SUBJECT:

Oil Filter Adapter (OFA) - Pressure Relief Valve Replacement

OVERVIEW:

This bulletin involves replacing the pressure relief valve in the OFA assembly.

MODELS:

2012 - 2013	(JC)	Dodge Journey
2013	(DS)	RAM 1500 Pickup
2012 - 2013	(JK)	Jeep Wrangler
2011 - 2013	(RT)	Chrysler Town & Country Dodge Caravan
2011 - 2013	(WK)	Jeep Grand Cherokee
2011 - 2013	(WD)	Dodge Durango
2011 - 2013	(JS)	Dodge Avenger Chrysler 200
2011 - 2013	(LD)	Dodge Charger
2011 - 2013	(LC)	Dodge Challenger
2011 - 2013	(LX)	Chrysler 300

NOTE: This bulletin applies to vehicles within the following markets/countries: NAFTA, LATAM, APAC and EMEA.

NOTE: This bulletin applies to vehicles equipped with the 3.6L V6 24V VVT Engine (Sales Code ERB).

SYMPTOM/CONDITION:

The technician may find when replacing an oil filter, the oil pressure relief valve is missing from the support stem of the OFA (Fig. 1) .

DIAGNOSIS:

NOTE: Inspect the oil filter adapter for any damage. If the supports are broken the replacement oil pressure relief valve may come loose. If there is damage to the oil pressure relief valve support (**Fig. 1**), the entire oil filter adapter will need to be replaced under normal service procedure and warranty.

1. While performing an oil filter change, examine the OFA for a missing or broken oil pressure relief valve (**Fig. 1**). If the oil pressure relief valve is missing or broken, proceed to [Step 1](#).

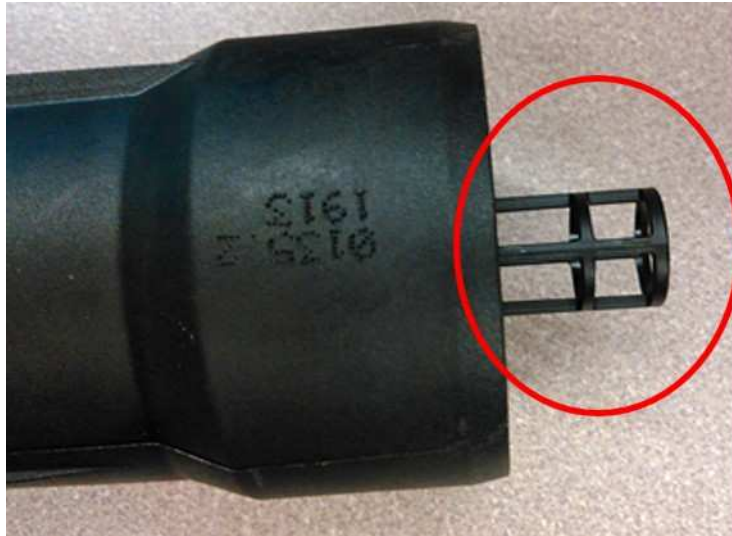


Fig. 1

Missing Oil Pressure Relief Valve Spring

If the technician finds the symptom/condition listed above, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	68385075AA	Valve, Oil Pressure Relief

NOTE: The replacement kit will include a new spring and valve.

REPAIR PROCEDURE:

1. If the oil pressure relief valve is missing install the new oil pressure relief valve. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info>09 - Engine, 3.6L/Lubrication/Valve, Oil Pressure Relief/Removal/Installation. (Fig. 2) .



Fig. 2
New Oil Pressure Relief Valve

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
09-55-02-91	Valve, Oil Pressure Relief - Installation (0 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------