



NUMBER: 16-002-13

GROUP: Prop Shaft / U-joint

DATE: July 30, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 13-054. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Rattle and/or Growl Noise on Hard Acceleration

OVERVIEW:

This bulletin involves verifying the noise on acceleration and replacing the propeller shaft if necessary.

MODELS:

2014 WK Grand Cherokee

NOTE: This bulletin applies to two wheel drive vehicles equipped with the 5.7L engine (Sales Code EZH) built before March 16, 2013 (MDH 0316XX).

SYMPTOM/CONDITION:

During a hard acceleration, the propeller shaft center bearing balance sleeve may contact the center CV joint can causing a growling and/or rattle noise.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
AR (1)	52123811AB	Propeller Shaft Assembly

REPAIR PROCEDURE:

1. Drive the vehicle in a safe location that will allow the vehicle to be accelerated aggressively.

2. From a stop, accelerate the vehicle in a forward direction with a medium to heavy acceleration. Do not allow the tires to break loose. The vehicle should not go into a ESC mode nor should the tires lose traction. Listen for a grinding, rattling, and/or growling noise coming from the underbody middle of the vehicle.
3. Repeat three times.
4. Was a grinding, rattling, and/or growling noise coming from the underbody middle of the vehicle?
 - a. YES>>>Proceed to the next step.
 - b. NO>>>This vehicle does not have contact between the propeller shaft center bearing balance sleeve and center CV joint can.
5. Replace the propeller shaft assembly (p/n 52123811AB). Refer to DealerCONNECT>TechCONNECT>Service Info>03 - Differential and Driveline>Propeller Shaft>SHAFT, Drive, Rear>Removal/Installation for additional information.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
16-30-01-92	Propeller Shaft, Rear - Verify Noise	3 - Driveline	0.2 Hrs.
16-30-01-93	Propeller Shaft, Rear - Verify Noise and Replace	3 - Driveline	1.6 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------