

NUMBER: 19-006-10

GROUP: Steering

DATE: December 16, 2010

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL 10-082. ALL APPLICABLE SOLD AND UN-SOLD VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Moan Like Sound During Parking Lot Maneuvers And/Or Fluid Weeping At Rack And Pinion

OVERVIEW:

This bulletin involves test driving the vehicle and/or inspecting the rack and pinion and if necessary replace.

MODELS:

2011 WK Grand Cherokee

NOTE: This information applies to vehicles built after May 20, 2010 (MDH0520XX) and built prior to August 19, 2010 (MDH0819XX).

SYMPTOM/CONDITION:

The customer may experience a moan like sound during parking lot maneuvers and/or fluid weeping at the rack and pinion.

DIAGNOSIS:

If the symptom/condition is experienced, proceed to the repair procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
(AR) 1	52124724AF	Gear, Rack and Pinion (With 5.7 V8 Engine or 4WD V6)
(AR) 1	68078525AB	Gear, Rack and Pinion (With 3.6L V6 Engine and Without 4WD)



19-006-10 -2-

REPAIR PROCEDURE:

- 1. Test drive the vehicle and verify moan like sound during parking lot maneuvers. Was there any moan noise?
 - a. Yes>>> Proceed to Step #3.
 - b. No>>> Proceed to Step #2.
- 2. Raise the vehicle on a suitable hoist. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info> 04- Vehicle Quick Reference> Hoisting> Standard Procedure> Hoisting.
- 3. Inspect the rack and pinion for any signs of power steering fluid weeping at the bellows (Fig. 1). Was there any power steering fluid weeping?

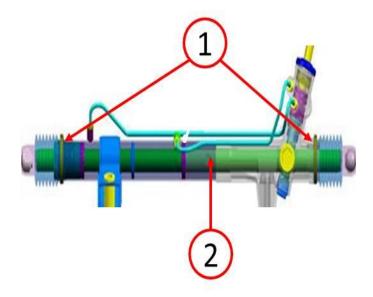


Fig. 1 Rack and Pinion

- 1 Bellows
- 2 Rack and Pinion
 - a. Yes>>> Proceed to Step #4
 - b. No>>> This bulletin does not apply continue further diagnosis.
- 4. Remove and replace the rack and pinion. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT under: Service Info> 19- Steering> Gear> Removal/Installation> 3.6L/5.7L.
- 5. Return the vehicle to the customer or dealer inventory.

-3- 19-006-10

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
19-00-01-92	Inspect Only (A)	0.2 Hrs.
19-00-01-93	Inspect and Replace Rack and Pinion (With 5.7 V8 Only) (A)	3.4 Hrs.
19-00-01-95	Inspect and Replace Rack and Pinion (3.6L V6 With 4x4 Only) (A)	2.5 Hrs.
19-00-01-94	Inspect and Replace Rack and Pinion (3.6L V6 With 4x2 Only) (A)	2.2 Hrs.
19-00-01-96	Inspect and Replace Rack and Pinion (3.6L V6 With Air Suspension (SER) Only) (A)	2.7 Hrs.

FAILURE CODE:

ZZ Service Action	ZZ	Service Action
---------------------	----	----------------