&\$\%\`K?'GFH,'!'MIRROR-INSIDE REARVIEW C1

Harness Family: Mirror_Int_Jumper Harness Part Number: 68079155AC

Cavities: 20 Color: BLACK Gender: Female

Part Description: USCAR 20P .64 CONNECTOR ASSY (CLUSTER)


Repair Kit Part Number: Not Available

Seal: Un-Sealed

Engineering Name: Assy_Mirror_Inside_RR_View_HFM_EC_Beam

Connector No: D6625A

Available Views: Location View

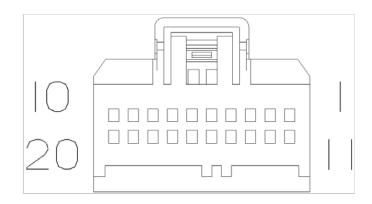

Pin	Circuit	Wire Color	Gauge	Function
A1	X712	DB/LB	22	MICROPHONE 1 IN (+)
A2	X792	DB/DG	22	MICROPHONE IN (-)
А3	X722	LB/DG	22	MICROPHONE 2 IN (+)
A4				NO CONNECTION
A 5				NO CONNECTION
A6	D265	WT/GY	22	CAN IHS BUS (125K) (+)
A7	D264	WT/OR	22	CAN IHS BUS (125K) (-)
A8	Z912	BK	18	GROUND
Α9	L1	WT/LG	18	BACKUP LAMP FEED
A10	X835	OR/GY	22	SENSOR GROUND
A11				NO CONNECTION
A12				NO CONNECTION
A13	F943	PK/LG	18	FUSED IGNITION RUN-START CONTROL OUTPUT
A14	P112	TN/OR	22	AUTO DAY/NIGHT MIRROR (+)
A15	X793	DG/YL	22	MICROPHONE FEED
A16	P114	TN/WT	22	AUTO DAY/NIGHT MIRROR (-)

A17	NO CONNECTION
A18	NO CONNECTION
A19	NO CONNECTION
A20	NO CONNECTION

